

English

Operating manual

Pyrgeometer LPPIRG01



Companies / Brands of GHM

Members of GHM GROUP:

GREISINGER HONSBERG Martens IMTRON Seltaces VAL.CO

www.deltaohm.com

Keep for future reference.

TABLE OF CONTENTS

1	INTRODUCTION	
2	WORKING PRINCIPLE	4
3	INSTALLATION	6
4	ELECTRICAL CONNECTIONS	9
	4.1 LPPIRG01 CONNECTIONS	9
	4.2 LPPIRG01S CONNECTIONS	
5	MEASUREMENT IN THE MODEL WITH ANALOG OUTPUT	
6	RS485 MODBUS-RTU OUTPUT	
	6.1 SETTING THE COMMUNICATION PARAMETERS	
	6.2 READING THE MEASURES WITH THE MODBUS-RTU PROTOCOL	
7	MAINTENANCE	
8	TECHNICAL SPECIFICATIONS	
9	SAFETY INSTRUCTIONS	
10	ORDERING CODES	

1 INTRODUCTION

LPPIRG01 pyrgeometer measures the far infrared radiation (FIR). The measures are referred to radiations with wavelength greater than 4.5 μ m.

The far infrared radiation derives from the measure of the thermopile output signal and from the knowledge of the instrument temperature. The temperature is measured with a 10 k Ω NTC inserted in the body of the pyrgeometer.

The pyrgeometer can be used also for energy balance studies. In this case, besides another pyrgeometer which measures infrared radiation upwards, it is necessary an albedometer (LPPYRA05, LPPYRA06 or LPPYRA11) for measuring the short wavelengths radiation (<3 μ m).

The pyrgeometer is available in the following versions:

- LPPIRG01: Passive
- **LPPIRG01S**: With RS485 Modbus-RTU output.

The pyrgeometer is supplied factory calibrated and with a calibration report. The calibration is carried out outdoors, for comparison with a reference standard pyrgeometer calibrated at WRC (World Radiation Center). The two instruments are kept outdoors for at least one night in the presence of clear sky. The data acquired by a data logger are then processed to obtain the calibration factor.

2 WORKING PRINCIPLE

LPPIRG01 pyrgeometer is based on a thermopile sensor. The thermopile sensitive surface is coated with a black matt paint, which allows the pyrgeometer not to be selective at different wavelengths.

The sensor is covered by a silicon window that has two basic purposes:

- 1. protect the thermopile from bad weather;
- 2. determine the instrument spectral range: silicon is transparent to wavelengths longer than 1.1 μ m, therefore on the inside of the window there is a filter to block radiation up to 4.5 5 μ m. The silicon external surface, which is exposed to weather agents, has a scratch-resistant coating (DLC) to ensure strength and durability in all weather conditions. The scratch-resistant coating offers the advantage of cleaning the surface without the risk of scratching the window. The transmission of the silicon window as the wavelength varies is shown in figure 2.1.

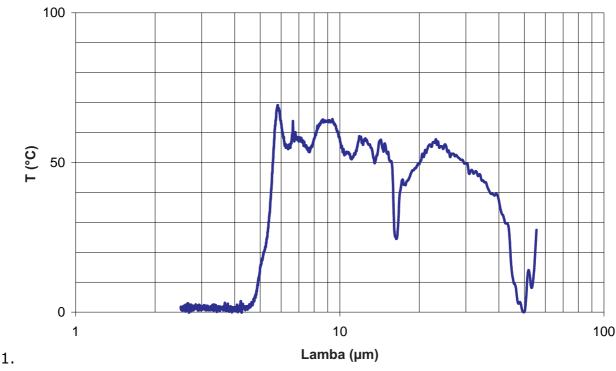


Fig. 2.1: Transmission of the silicon window

Radiant energy is absorbed/radiated by the thermopile black surface, thus creating a difference of temperature between the center of the thermopile (hot junction) and the pyrgeometer body (cold junction). Thanks to the Seebeck effect, the difference of temperature between hot and cold junction is converted into a Difference of Potential.

If the pyrgeometer temperature is higher than the radiant temperature of the portion of sky framed by the pyrgeometer, the thermopile will irradiate energy and the output signal will be negative (typical situation of clear sky); vice versa, if the pyrgeometer temperature is lower than that portion of sky framed, the signal will be positive (typical situation of cloudy sky).

Therefore, for the calculation of infrared radiation at ground level ($E_{FIR} \downarrow$), besides the thermopile output signal, it is necessary to know the temperature of the pyrgeometer, as shown in formula 1:

$$\mathsf{E}_{\mathsf{FIR}} \downarrow = \mathsf{E}_{\mathsf{term}} + \sigma \mathsf{T}_{\mathsf{B}}^4 \tag{1}$$

Where:

 E_{term} = net radiation (positive or negative) measured by the thermopile (W m⁻²);

 σ = Stefan-Boltzmann constant (5.6704 x 10⁻⁸ W m⁻² K⁻⁴);

 T_B = pyrgeometer temperature (K), obtained by the reading of the NTC resistance (see table 5.1).

 E_{term} is calculated from the sensitivity of the instrument **C** [μ V/(W m⁻²)] and from the output signal **U**_{emf} according to formula 2:

$$E_{term} = U_{emf} / C$$
 (2)

The first term of formula 1 represents the net radiation, that is to say the difference between ground infrared radiation and the pyrgeometer emission, while the second term is the radiation emitted by an object (assuming emissivity $\epsilon = 1$) at temperature T_B.

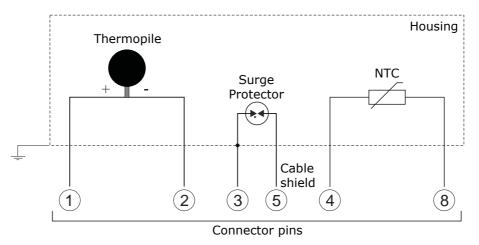


Fig. 2.2: scheme of principle LPPIRG01 (version with mV output)

To prevent internal condensation forming on the internal side of the window under certain climatic conditions, silica gel tablets are inserted inside the pyrgeometer to absorb humidity.

3 INSTALLATION

Before installing the pyrgeometer, refill the cartridge containing silica-gel crystals. Silica-gel absorbs humidity inside the instrument and prevents, in particular climatic conditions, condensation on the internal surface of the silicon window and measurement alteration.

Do not touch the silica gel crystals with your hands while refilling the cartridge. Carry out the following instructions in an environment as drier as possible:

- 1. Loosen the three screws that fix the white shade disk.
- 2. Unscrew the silica gel cartridge using a coin.
- 3. Remove the cartridge perforated cap.
- 4. Open the sachet containing silica gel (supplied with the pyrgeometer).
- 5. Fill the cartridge with the silica gel crystals.
- 6. Close the cartridge with its own cap, paying attention that the sealing O-ring be properly positioned.
- 7. Screw the cartridge to the pyrgeometer body using a coin.
- 8. <u>Check that the cartridge is screwed tightly</u> (if not, silica gel life will be reduced).
- 9. Position the shade disk and screw it with the screws.
- 10. The pyrgeometer is ready for use.

The figure below shows the operations necessary to fill the cartridge with the silica gel crystals.

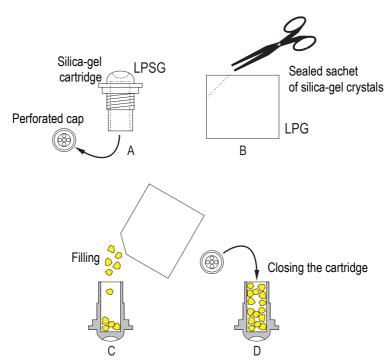


Fig. 3.1: filling the silica-gel cartridge

- The pyrgeometer must be mounted in an easy-to-reach location in order to clean the silicon window regularly. At the same time, make sure that no buildings, constructions, trees or obstructions exceed the horizontal plane where the pyrgeometer lies. If this is not possible, select a site where obstructions do not exceed 10°.
- In compliance with ISO TR9901 standard and WMO recommendations, when the pyrgeometer is used without the white shade disk, it must be positioned so that its connector is pointed to the North Pole, if the instrument is used in the Northern Hemisphere, and to the South Pole, if used in the Southern Hemisphere. In any case, it is better to follow this suggestion even when the shade disk is applied.
- For fixing, use the holes on the pyrgeometer body (remove the shade disk to access the holes and reposition it after mounting) or the suitable accessories (see the figures below). In order to allow an accurate horizontal positioning, the pyrgeometer is equipped with a levelling device: the adjustment is made by means of the two levelling screws that allow adjusting the pyrgeometer inclination.
- It is preferably to thermally insulate the pyrgeometer from its mounting bracket ensuring, at the same time, a good electrical contact to ground.

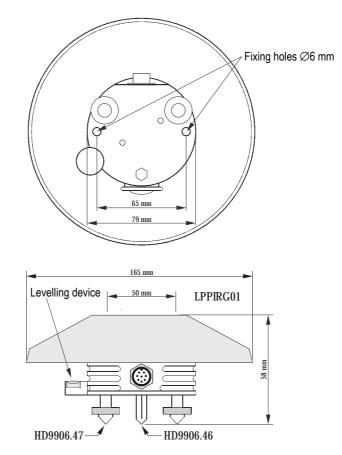


Fig. 3.2: fixing holes and levelling device

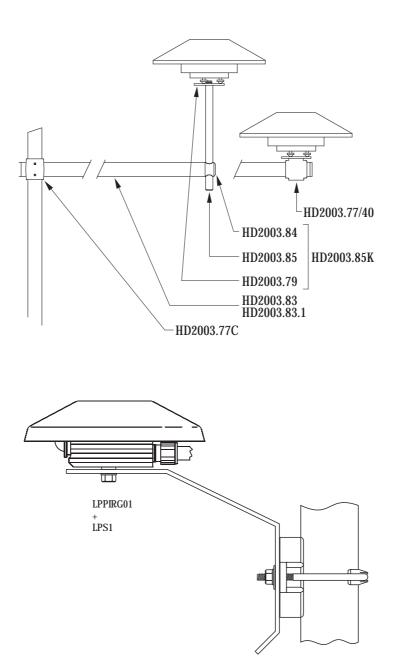


Fig. 3.3: fixing accessories

4 ELECTRICAL CONNECTIONS

The pyrgeometer has a 8-pole connector and uses the **CPM12AA8PG...** (LPPIRG01) or **CPM12-8D...** (LPPIRG01S) **optional** cables in UV resistant PTFE, with 8-pole connector on one side and open wires on the other side.



The metallic housing of the pyrgeometer should preferably be grounded (\pm) locally. In this case, do not connect the wire of the cable corresponding to the housing to prevent ground loops.

Only if it is not possible to ground locally the metallic case of the pyrgeometer, connect the wire of the cable corresponding to the housing to ground (\pm).

The wire of the cable corresponding to the housing depends on the model: white wire in LPPIRG01 and black wire (cable shield) in LPPIRG01S.

4.1 LPPIRG01 CONNECTIONS

The pyrgeometer LPPIRG01 is passive and does not require power supply. It is to be connected either to a millivoltmeter or to a data acquisition system. Typically, the pyr-geometer output signal absolute value does not exceed 4 mV. In order to better exploit the pyrgeometer features, the readout instrument should have 1 μ V resolution.

To determine the pyrgeometer temperature	e, the NTC resistance must be read.
--	-------------------------------------

Connector	Function	Color
1	Vout (+)	Red
2	Vout (-)	Blue
3	Housing	White
4	NTC	Green
5	Cable shield	Brown
6	Not connected	
7	Not connected	
8	NTC	Black

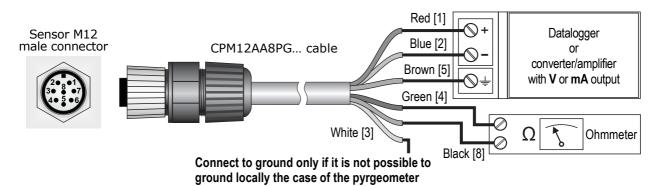


Fig. 4.1: LPPIRG01connections

4.2 LPPIRG01S CONNECTIONS

The pyrgeometer LPPIRG01S has **RS485 Modbus-RTU** output and requires **5...30 Vdc** external power supply. It is to be connected to a power supply and to a PLC, a data logger or a RS485/USB or RS485/RS232 converter for PC as shown in fig. 4.2. The RS485 output is not isolated.

Connector	Function	Color
1	Power supply negative (GND)	Blue
2	Power supply positive (+Vdc)	Red
3	Not connected	
4	RS485 A/-	Brown
5	RS485 B/+	White
6	Housing	Shield (Black)
7	Not connected	
8	Not connected	

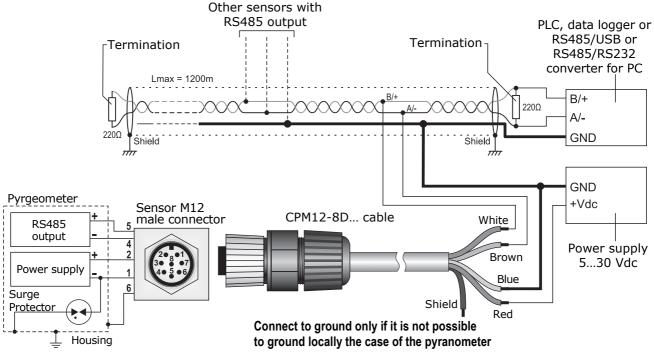


Fig. 4.2: LPPIRG01S connections

Before connecting the pyrgeometer to the RS485 network, set the address and the communication parameters, if different from the factory preset (see chapter 6).

5 MEASUREMENT IN THE MODEL WITH ANALOG OUTPUT

Measure the NTC resistance $\mathbf{R}_{NTC}(\Omega)$ and calculate the pyrgeometer temperature $\mathbf{T}_{B}(K)$ by using the formula 3:

$$\frac{1}{\mathbf{T}_{B}} = \mathbf{a} + \mathbf{b} \log(\mathbf{R}_{NTC}) + \mathbf{c} \log(\mathbf{R}_{NTC})^{3}$$
(3)

Where:

b = 2390.6 x
$$10^{-7}$$

 $\mathbf{c} = 1.5677 \times 10^{-7}$

The temperature is expressed in Kelvin.

Table 5.1 indicates the correspondence between T_B and R_{NTC} for temperature values between -25 °C and +58 °C. To obtain the temperature value in Kelvin, add 273.15 to the temperature value in degrees Celsius in the table.

TAB. Errore. L'origine riferimento non è stata trovata..1: correspondence between pyrgeometer temperature and NTC resistance

Т в (°С)	R ntc (Ω)	Т в (°С)	R ntc (Ω)	Т в (°С)	R ntc (Ω)
-25	103700	3	25740	31	7880
-24	98240	4	24590	32	7579
-23	93110	5	23500	33	7291
-22	88280	6	22470	34	7016
-21	83730	7	21480	35	6752
-20	79440	8	20550	36	6499
-19	75390	9	19660	37	6258
-18	71580	10	18810	38	6026
-17	67970	11	18000	39	5804
-16	64570	12	17240	40	5592
-15	61360	13	16500	41	5388
-14	58320	14	15810	42	5193
-13	55450	15	15150	43	5006
-12	52740	16	14520	44	4827
-11	50180	17	13910	45	4655
-10	47750	18	13340	46	4489
-9	45460	19	12790	47	4331
-8	43290	20	12270	48	4179
-7	41230	21	11770	49	4033
-6	39290	22	11300	50	3893
-5	37440	23	10850	51	3758
-4	35690	24	10410	52	3629
-3	34040	25	10000	53	3505
-2	32470	26	9605	54	3386
-1	30980	27	9228	55	3386
0	29560	28	8868	56	3271
1	28220	29	8524	57	3161
2	26950	30	8195	58	3055

Once the pyrgeometer temperature T_B in Kelvin and the thermopile output signal U_{emf} in μV (measured with a multimeter) are known, irradiation $E_{FIR} \downarrow$ (W m⁻²) is obtained from the formula 4:

$$E_{FIR} \downarrow = \frac{U_{emf}}{C} + \sigma T_B^4$$
 (4)

Where:

 σ = Stefan-Boltzmann constant (5.6704 x 10⁻⁸ W m⁻² K⁻⁴);

 T_B = sensitivity of the instrument expressed in $\mu V/(Wm^{-2})$ and shown in the label on the pyrgeometer (and in the calibration report).


6 RS485 MODBUS-RTU OUTPUT

Before connecting the pyrgeometer to the RS485 network, an address must be assigned and the communication parameters must be set, if different from the factory preset.


6.1 SETTING THE COMMUNICATION PARAMETERS

Connect the pyrgeometer to the PC in one of the following two ways:

A. By using the optional **CP24** cable, with built-in RS485/USB converter. In this connection mode, the sensor is powered by the PC USB port. To use the cable, it is necessary to install the related USB drivers in the PC.

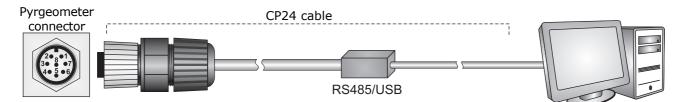

B. By using the supplied 8-pole M12 female connector or the optional **CPM12-8D**... cable and a generic RS485/USB or RS485/RS232 converter. In this connection mode, it is necessary to power the pyrgeometer separately. If a RS485/USB converter is used, it is necessary to install the related USB drivers in the PC.

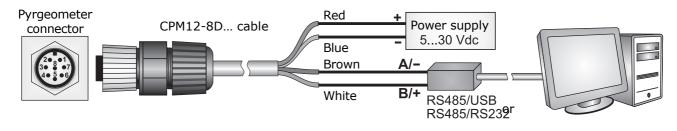

NOTES ON THE INSTALLATION OF UNSIGNED USB DRIVER: before installing unsigned USB driver into operating systems starting from Windows 7, it is necessary to restart the PC by disabling the driver signing request. If the operating system is 64-bit, even after installation the request of driver signing have to be disabled each time the PC is restarted.

Procedure:

- **1.** Start with the pyrgeometer not powered (if the CP24 cable is used, disconnect one end of the cable).
- **2.** In the PC, start a serial communication program. Set the Baud Rate to 57600 and set the communication parameters as follows (the pyrgeometer is connected to a COM type port):

Data Bits: 8 Parity: None Stop Bits: 2

In the program, set the COM port number to which the pyrgeometer will be connected.

3. Switch the pyrgeometer on (if the CP24 cable is used, connect both ends of the cable).

4. Within 10 seconds from the pyrgeometer power on, send the **@** command and press **Enter**.

Note: if the pyrgeometer does not receive the **@** command within 10 seconds from power on, the RS485 MODBUS mode is automatically activated. In such a case, it is necessary to switch off and on again the pyrgeometer.

5. Send the command CAL USER ON.

Note: the command CAL USER ON is disabled after 5 minutes of inactivity.

6. Send the serial commands given in the following table to set the RS485 MODBUS parameters:

Command	Response	Description	
CMAnnn	&	Set RS485 address to nnn	
		Ranging from 1 to 247	
		Preset on 1	
CMBn	&	Set RS485 Baud Rate	
		$\begin{array}{ll} n=0 \Rightarrow 9600 & n=1 \Rightarrow 19200 & n=2 \Rightarrow 38400 \\ n=3 \Rightarrow 57600 & n=4 \Rightarrow 115200 \end{array}$	
		Preset on 1 \Rightarrow 19200	
CMPn	&	Set RS485 transmission mode	
		$\begin{array}{l} n=0 \Rightarrow 8\text{-}N\text{-}1 & (8 \text{ data bits, no parity, 1 stop bit}) \\ n=1 \Rightarrow 8\text{-}N\text{-}2 & (8 \text{ data bits, no parity, 2 stop bits}) \\ n=2 \Rightarrow 8\text{-}E\text{-}1 & (8 \text{ data bits, even parity, 1 stop bit}) \\ n=3 \Rightarrow 8\text{-}E\text{-}2 & (8 \text{ data bits, even parity, 2 stop bits}) \\ n=4 \Rightarrow 8\text{-}O\text{-}1 & (8 \text{ data bits, odd parity, 1 stop bit}) \\ n=5 \Rightarrow 8\text{-}O\text{-}2 & (8 \text{ data bits, odd parity, 2 stop bits}) \\ Preset on 2 \Rightarrow 8\text{-}E\text{-}1 \end{array}$	
CMWn	8	Set receiving mode after RS485 transmission	
	~1	$n=0 \Rightarrow$ Violate protocol and go in Rx mode right after Tx $n=1 \Rightarrow$ Respect protocol and wait 3.5 characters after Tx Preset on 1 \Rightarrow Respect the protocol	

7. You can check the parameters setting by sending the following serial commands:

Command	Response	Description	
RMA	Address	Read RS485 address	
RMB	Baud Rate	Read RS485 Baud Rate	
	(0,1)	$\begin{array}{ll} 0 \Rightarrow 9600 & 1 \Rightarrow 19200 & 2 \Rightarrow 38400 \\ 3 \Rightarrow 57600 & 4 \Rightarrow 115200 \end{array}$	
RMP	<i>Tx Mode</i> (0,1,2,3,4,5)	Read RS485 transmission mode $0 \Rightarrow 8$ -N-1 $1 \Rightarrow 8$ -N-2 $2 \Rightarrow 8$ -E-1 $3 \Rightarrow 8$ -E-2 $4 \Rightarrow 8$ -O-1 $5 \Rightarrow 8$ -O-2	
RMW	Rx Mode (0,1)	Read receiving mode after RS485 transmission $0 \Rightarrow$ Violate protocol and go in Rx mode right after Tx $1 \Rightarrow$ Respect protocol and wait 3.5 characters after Tx	

Note: it is not required to send the CAL USER ON command to read the settings.

6.2 READING THE MEASURES WITH THE MODBUS-RTU PROTOCOL

In MODBUS mode, you can read the values measured by the pyrgeometer through the function code 04h (Read Input Registers). The following table lists the quantities available with the appropriate register address:

Number	Address	Quantity	Format
1	0	Temperature in °C (x10)	16-bit Integer
2	1	Temperature in °F (x10)	16-bit Integer
3	2	Solar radiation in W/m ²	16-bit Integer
4	3	Status register: $bit0=1 \Rightarrow solar radiation measurement error$ $bit2=1 \Rightarrow configuration data error$ $bit3=1 \Rightarrow program memory error$	16-bit Integer
5	4	Average values of the last 4 measurements	16-bit Integer
6	5	Signal generated by the sensor in μ V/10 [e.g.: 816 means 8160 μ V, the resolution is 10 μ V]	16-bit Integer

Note: Register address = Register number - 1, as defined in the Modbus standard.

OPERATING MODE: the pyrgeometer enters RS485 MODBUS-RTU mode after 10 seconds from power on. In the first 10 seconds from power on the pyrgeometer does not reply to requests from the MODBUS master unit. After 10 seconds, it is possible to send MODBUS requests to the pyrgeometer.

7 MAINTENANCE

In order to grant measurements high accuracy, it is important to keep the silicon window clean. Consequently, the more the dome will be kept clean, the more measurements will be accurate.

You can wash it using water and standard papers for lens. If necessary, use pure ETHYL alcohol. After using alcohol, clean again the silicon window with water only.

Because of the high temperature changes between day and night, some condensation might appear inside the pyrgeometer (especially on the silicon window). In this case the performed reading is wrong. To minimize the condensation, the pyrgeometer is provided with a cartridge containing dessicant material (silica-gel). The efficiency of the silica-gel crystals decreases over time while absorbing humidity. Silica-gel crystals are efficient when their color is **yellow**, while they turn **white/translucent** as soon as they lose their efficiency. Read instructions at chapter 3 about how to replace the silica-gel crystals. Silica-gel typical lifetime goes from 2 to 6 months depending on the environment where the pyrgeometer works.

Hail of particular intensity/size may damage the silicon window; therefore, it is recommended to check the status of the window after an intense storm with hail.

To exploit all the pyrgeometer features, it is highly recommended that the calibration be checked annually.

8 TECHNICAL SPECIFICATIONS

1
Thermopile
5÷10 µV/Wm ⁻²
33÷45 Ω
-300÷+300 W/m ²
160°
5.5÷45 μm
-40÷80 °C
Analog in µV/Wm ⁻² (LPPIRG01) Digital RS485 Modbus-RTU (LPPIRG01S)
5÷30 Vdc (LPPIRG01S)
8-pole M12 connector
Fig. 3.2
0.9 kg
< 0.1°
IP 67
> 10 years

Technical Specifications According to ISO 9060:2018

Response time (95%)	< 28 s
Zero offset (type B)	
a) response to a 5 K/h change in am- biente temperature	< ±4 W/m ²
Long-term instability (1 year)	< ±1.5 %
Non-linearity	< ±1 %
Spectral selectivity	< ±5 %
Temperature response	< 3 %
Tilt response	< ±2 %

9 SAFETY INSTRUCTIONS

General safety instructions

The instrument has been manufactured and tested in accordance with the safety standard EN61010-1:2010 "Safety requirements for electrical equipment for measurement, control and laboratory use" and has left the factory in perfect safety technical conditions.

The instrument proper operation and operating safety can be ensured only if all standard safety measures as well as the specific measures described in this manual are followed.

The instrument proper operation and operating safety can be ensured only in the climatic conditions specified in this manual.

Do not use the instruments in places where there are:

- Corrosive or flammable gases.
- Direct vibrations or shocks to the instrument.
- High-intensity electromagnetic fields, static electricity.

User obligations

The instrument operator shall follow the directives and regulations below that refer to the treatment of dangerous materials:

- EEC directives on workplace safety.
- National law regulations on workplace safety.
- Accident prevention regulations.

10 ORDERING CODES

- LPPIRG01 Pyrgeometer. Complete with shade disk, cartridge for silica-gel crystals, 2 spare sachets, levelling device, M12 8-pole connector and Calibration Report. CPM12AA8PG... cable has to be or-dered separately.
- LPPIRG01S Pyrgeometer. Complete with shade disk, cartridge for silica-gel crystals, 2 spare sachets, levelling device, M12 8-pole connector and Calibration Report. RS485 Modbus-RTU output. Power supply 5...30 Vdc. CPM12-8D... cable has to be ordered separately.
- **LPSP1** UV-resistant shade disk.
- **LPS1** Fixing bracket for the pyrgeometer, suitable for \emptyset 40 \div 50 mm mast. Installation on horizontal or vertical mast.
- **HD2003.79K** Kit to mount the pyrgeometer on Ø40 mm clamping. To install the pyranometer on a transverse mast.
- **HD2003.85K** Kit with adjustable height to mount the pyrgeometer on a Ø40 mm mast.
- **CPM12AA8PG.2** Cable with 8-pole M12 connector on one end, open wires on the other end. Length 2 m.
- **CPM12AA8PG.5** Cable with 8-pole M12 connector on one end, open wires on the other end. Length 5 m.
- **CPM12AA8PG.10** Cable with 8-pole M12 connector on one end, open wires on the other end. Length 10 m.
- **CPM12-8D.2** Cable with 8-pole M12 connector on one end, open wires on the other end. Length 2 m.
- **CPM12-8D.5** Cable with 8-pole M12 connector on one end, open wires on the other end. Length 5 m.
- **CPM12-8D.10** Cable with 8-pole M12 connector on one end, open wires on the other end. Length 10 m.
- **CP24** PC connecting cable for the RS485 MODBUS parameters configuration of the LPPIRG01S pyrgeometer. With built-in RS485/USB converter. 8-pole M12 connector on instrument side and A-type USB connector on PC side.
- **LPSG** Cartridge to contain desiccant silica-gel crystals, complete with O-ring and cap.
- **LPG** Pack of 5 sachets of silica-gel crystals.

DELTA OHM metrology laboratories LAT N° 124 are ISO/IEC 17025 accredited by AC-CREDIA for Temperature, Humidity, Pressure, Photometry / Radiometry, Acoustics and Air Velocity. They can supply calibration certificates for the accredited quantities.

Notes

Notes

Notes



CE DICHIARAZIONE DI CONFORMITÀ UE EU DECLARATION OF CONFORMITY

Delta Ohm S.r.L. a socio unico - Via Marconi 5 - 35030 Caselle di Selvazzano - Padova - ITALY

Documento Nr. / Mese.Anno: Document-No. / Month. Year :

5152 / 02.2020

Si dichiara con la presente, in qualità di produttore e sotto la propria responsabilità esclusiva, che i seguenti prodotti sono conformi ai requisiti di protezione definiti nelle direttive del Consiglio Europeo: We declare as manufacturer herewith under our sole responsibility that the following products are in compliance with the protection requirements defined in the European Council directives:

Codice prodotto: *Product identifier* :

LPPIRG01 – LPPIRG01S

Descrizione prodotto: *Product description* :

Pirgeometro Pyrgeometer

I prodotti sono conformi alle seguenti Direttive Europee: The products conform to following European Directives:

Direttive / Directives	
2014/30/EU	Direttiva EMC / EMC Directive
2014/35/EU	Direttiva bassa tensione / Low Voltage Directive
2011/65/EU	RoHS / RoHS

Norme armonizzate applicate o riferimento a specifiche tecniche: Applied harmonized standards or mentioned technical specifications:

Norme armonizzate / Harmonized standards		
EN 61010-1:2010	Requisiti di sicurezza elettrica / Electrical safety requirements	
EN 61326-1:2013	Requisiti EMC / EMC requirements	
EN 50581:2012	RoHS / RoHS	

Il produttore è responsabile per la dichiarazione rilasciata da: The manufacturer is responsible for the declaration released by:

Johannes Overhues

Amministratore delegato Chief Executive Officer

Caselle di Selvazzano, 24/02/2020

Chung Delug

Questa dichiarazione certifica l'accordo con la legislazione armonizzata menzionata, non costituisce tuttavia garanzia delle caratteristiche.

This declaration certifies the agreement with the harmonization legislation mentioned, contained however no warranty of characteristics.

GUARANTEE



TERMS OF GUARANTEE

All DELTA OHM instruments are subject to accurate testing, and are guaranteed for 24 months from the date of purchase. DELTA OHM will repair or replace free of charge the parts that, within the warranty period, shall be deemed non efficient according to its own judgement. Complete replacement is excluded and no damage claims are accepted. The DELTA OHM guarantee only covers instrument repair. The guarantee is void in case of incidental breakage during transport, negligence, misuse, connection to a different voltage than that required for the appliance by the operator. Finally, a product repaired or tampered by unauthorized third parties is excluded from the guarantee. The instrument shall be returned FREE OF SHIPMENT CHARGES to your dealer. The jurisdiction of Padua applies in any dispute.



The electrical and electronic equipment marked with this symbol cannot be disposed of in public landfills. According to the Directive 2011/65/EU, the european users of electrical and electronic equipment can return it to the dealer or manufacturer upon purchase of a new one. The illegal disposal of electrical and electronic equipment is punished with an administrative fine.

This guarantee must be sent together with the instrument to our service centre. IMPORTANT: Guarantee is valid only if coupon has been correctly filled in all details.

Instrument Code:	LPPIRG01	
Serial Number		
RENEWALS		
Date	Date	
Inspector	Inspector	
Date	Date	
Inspector	Inspector	
Date	Date	
Inspector	Inspector	



GHM GROUP – Delta OHM | Delta Ohm S.r.I. a socio unico Via Marconi 5 | 35030 Caselle di Selvazzano | Padova | ITALY Phone +39 049 8977150 | Fax +39 049 635596 www.deltaohm.com | info@deltaohm.com



The quality level of our instruments is the result of the constant development of the product. This may produce some differences between the information written in this manual and the instrument you have purchased. We cannot completely exclude the possibility of errors in the manual, for which we apologize.

The data, images and descriptions included in this manual cannot be legally asserted. We reserve the right to make changes and corrections with no prior notice.

GHM GROUP – Delta OHM | Delta Ohm S.r.l. a socio unico Via Marconi 5 | 35030 Caselle di Selvazzano | Padova | ITALY Phone +39 049 8977150 | Fax +39 049 635596 www.deltaohm.com | info@deltaohm.com



V2.2 08/01/2021